

Jacobsen Information Bulletin

Product Type: JZT2 Ref. No. 001 Bulletin No: C-011-04

March 12, 2004

Kawasaki FH680V/FH721V Remote Engine Air Filter

Product Information

ISSUE:

Kawasaki Motors Corp., U.S.A. has found that the intake elbow on model FH vertical shaft engines equipped with the canister air filter kit may be warped.

CORRECTION:

Follow instructions on the attached Kawasaki bulletin.

INVOLVED PRODUCTS:

Model 742222A	Serial numbers 74222200101 up to and including 74222200127
Model 742223A	Serial numbers 74222300101 up to and including 74222300124
Model 742233A	Serial numbers 74223300101 up to and including 74223300121

WARRANTY:

This bulletin is for informational purposes only. Please contact Kawasaki Motors Corp., U.S.A. with questions at 1-866-836-4463.

CustomerOne[™] Product Support

This bulletin is rele	evant to the departme	nts shown below.	Please circulate	as appropriate
SERVICE X	WARRANTY X	SALES	PARTS X	





Factory Directed Modification

ENG 04-01

Heavy Duty Canister Air Filter Intake Pipe Modification

(FH 601V, 641V, 680V, 721V)

Jan. 12, 2003

Subject

Sealing area between the intake pipe and carburetor is deformed.

Kawasaki Action


Kawasaki has reinforced the intake pipe and added a bead on the gasket. Kawasaki has also reworked engines in inventory and initiated a Factory Directed Modification (FDM) campaign to repair eligible field units. Each machine manufacture will notify end users of this campaign and direct them to an authorized dealer for repair.

Eligibility

Eliqible Units

ingible Office				
Model	Eligibility	Serial number Range		
FH601V	Any engine that has Heavy Duty Canister Air Filter installed.	Before B55460		
		Before B16642		
I EHNXIIV		Before B28625		
FH721V		Before B25280		

Engines in the above serial numbers range are eligible. Engines with a white dot painted on the **breather hose**, have been reworked before shipping to dealers and are not eligible for this repair even if they are in the above range.

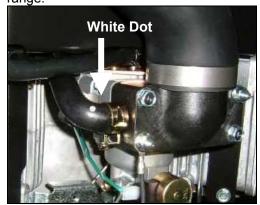


Dealer Action

Repair Eligible Units:

Repair all eligible units that have a heavy-duty canister air filter by installing a new reinforced plastic intake pipe and beaded gasket.

Bolt Torque Specs: 4.3-5.7 ft/lbs.

Make sure to follow bolt torque pattern.

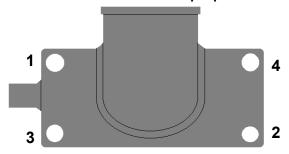

Parts Information

Kawasaki has created a repair kit for this campaign, so please order them as required through the normal parts ordering system.

Part Name	Part Number
Kit	99999-7038
Parts Contained	Intake Pipe
Paris Contained	Gasket

Kit contains intake pipe and beaded gasket.

Old Parts



New Parts



Gasket should be installed with the tab down.

Warranty Information

This is a Factory Directed Modification (FDM). The labor and parts costs will be reimbursed upon your warranty claim request.

Models	FH 601V, 641V, 680V,
	721V
Flat Rate Time	.5 hrs.
Causal Part	Intake Pipe
Causal Part No.	16060-7005
Qty	1
Labor Code	2306
Claim Type	3

Spare Parts

Some dealers may have Heavy Duty Canister
Accessory Kits in their parts inventory. These kits may
have the old intake elbow and gasket and need to have
the parts replaced inside the kit. Kawasaki will replace
the parts at no charge.

Dealers will need to call the Kawasaki Technical Hotline (866-836-4463) and give the quantity of kits they will need. The hotline will then send the kits out UPS ground to the dealer.

Kits or individual parts that need to have intake &		
gasket changed.		
Description	Part Number	
Canister Kit	99999-7007	
Canister Kit	99999-7008	
Canister Kit	99999-7010	
Canister Kit	99999-7011	
Canister Kit	99999-7012	
Intake	16060-7005	
Gasket	11060-7009	