



Bobcat/Bunton Service Bulletin

Product Type: ZT2

Ref. No. N/A

Bulletin No: C-012-05

March 14, 2005

Crankshaft Spacing


Action Required

ISSUE:

It has come to our attention that the crankshaft spacing may not be correct.

CORRECTION:

Remove the clutch-mounting bolt from the center of the crankshaft. Remove the Clutch and drive pulley. Install Machinery Bushings 64163-44 (quantity of 4) above the Pump Drive Pulley. Reinstall the clutch and torque the clutch-mounting bolt to 50 ft/lbs.

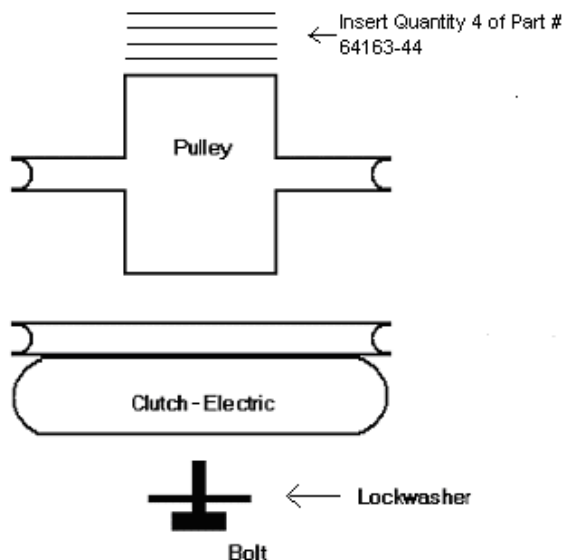

PARTS INVOLVED:

4121339, 64163-44 and 2721337

INVOLVED PRODUCTS:

942236 serial numbers 94223600140 up to and including 0163
942243A serial numbers 94224300070, 0071 and 0102 - 0105



WARRANTY:

You may claim parts and up to 20 minutes of labor allowed for units covered under this bulletin. Please file warranty, using **Factory Approval Number C-012-05**, with one unit per claim. If you have any questions please contact the Johnson Creek Customer Service Team at 1-800-848-1636 option 2,2.

All repairs must be completed by April 1, 2005. No warranty claims for this repair will be processed after May 1, 2005.

CustomerOne™ Product Support

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒

