

Jacobsen Service Bulletin

Product Type: Z FASTCAT PLUS ES

Ref. No. N/A

Bulletin No: C-025-04

June 21, 2004

Crankshaft Spacing


Action Required

ISSUE:

It has come to our attention that the crankshaft spacing may not be correct.

CORRECTION:

Remove the clutch mounting bolt from the center of the crankshaft. Remove the Clutch 2722016 and install a Machinery Bushing 64163-44 between the clutch and Pump Drive Pulley 4132287. Reinstall the clutch and torque the clutch mounting bolt to 50 ft/lbs.

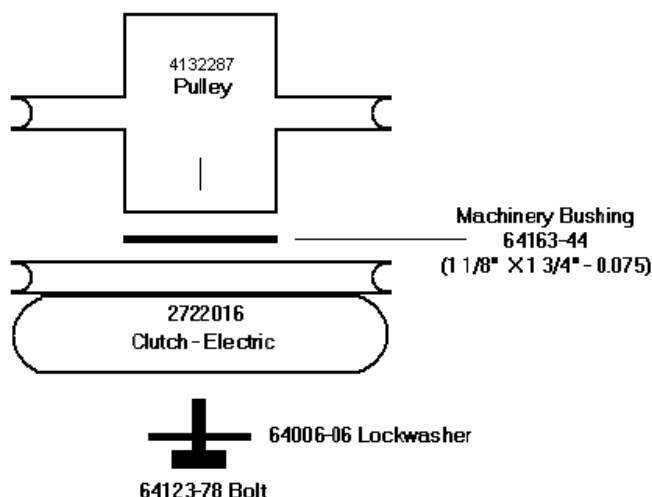

AFFECTED SERIAL NUMBERS:

All serial numbers for the following models:

742284 serial numbers 7422840070 – 0079, 0101

745585 serial numbers 7422850070 - 0073

**WARRANTY:**

You may claim parts and up to 20 minutes of labor allowed for units covered under this bulletin. Please file warranty, using **Factory Approval Number C-025-04**, with one unit per claim. If you have any questions please contact the Johnson Creek Customer Service Team at 1-800-848-1636 option 2,2.

All repairs must be completed by December 21, 2004. No warranty claims for this repair will be processed after January 21, 2005.

CustomerOne™ Product Support

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒

