

February 2001

**Hydraulic Oil Cooler
Hardware Interference**

**Models Affected:
642220, 642221, 642222
642223, 642233**

Issue

We have found on some units that the hydraulic oil cooler hose mounting hardware interferes with the seat mounting plate. This may cause the seat not to close completely.

Correction

Please check that the seat mounting plate is not hitting on the upper right hose clamp hardware. If the seat plate is hitting on this 64205-007 bolt and 64237-03 nut please replace them with a **64205-001** bolt and a **64237-05** nut.

Effective Serial Number

All 642220, 642221, 642222, 642223, and 642233 units.

Warranty

You may claim up to 15 minutes labor and parts for units within the normal warranty period. Please file warranty in the normal manner with one unit per claim.

Parts Involved

- 1) 64205-007 M8 Bolt.
- 1) 64237-03 M8 Nut.
- 1) 64205-001 M6 Bolt.
- 1) 64237-05 M6 Nut.

If you have any questions about this bulletin, please contact the Textron Golf, Turf And Specialty Products Service Department at 920-699-5890.