

April 2001

Hour Meter Wiring


Models Affected: 942211

Issue

It has come to our attention that the Hour Meter **48030N** on the 218 ES is not properly wired.

Correction

Disconnect the battery and locate the jumper harness **2722013** at the left-side of the engine. Cut the green wire at the white connector end of the harness. Install the green wire into the auto-loom with the yellow/black wire routed to the engine start solenoid **38665**. Install a #10 ring terminal to the green wire and install it with the black wire on the engine start solenoid. Reconnect the battery, start the unit and check that the hour meter is running.

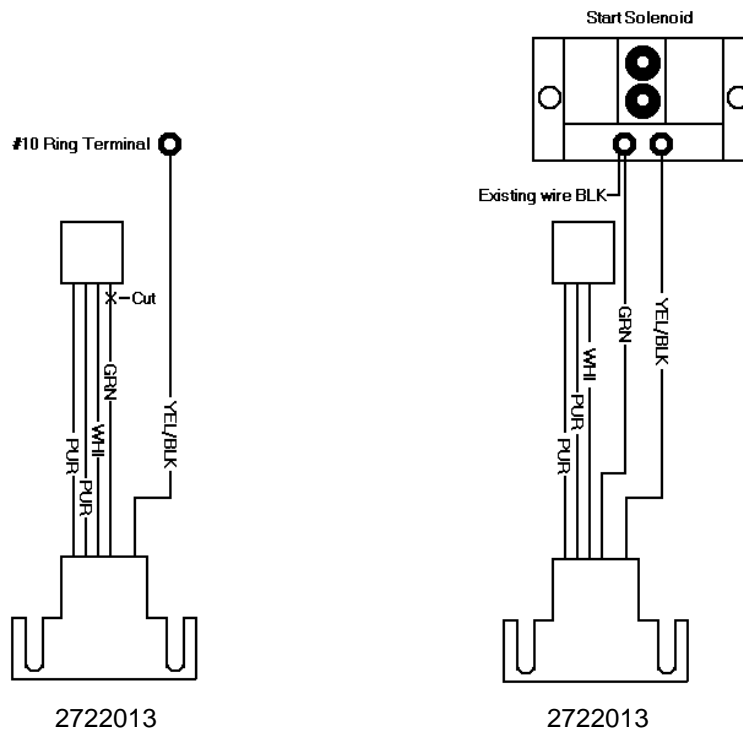

Effective Serial Number

942211– Serial numbers starting at 94221100101 up to and including 94221100613.
Excluding 94221100419, 94221100470, 94221100471, 94221100472, 94221100518,
and 94221100560.

Warranty

You may claim up to 20 minutes for this repair. Please file warranty in the normal manner with one unit per claim.

Parts Involved

2722010 Briggs 18HP Intek Engine.
48030N Hour Meter.
38665 Starter Solenoid.
2722013 Wire Harness.

If you have any questions about this bulletin, please contact the
Textron Golf, Turf And Specialty Products Service Department at 920-699-5890.