

April 2001

### **Suspension Seat Spacers and Slide Rail Alignment**

**Models Affected:**  
**942220, 942221, 942222**  
**942223, 942224, 942225, 942226**

#### **Issue**

We have received some reports from the field of Seat Spacers missing in the New Suspension Seat. This may cause the seat not to properly slide.

#### **Correction**

Please check that each seat has the following spacers located between the slide rails and the seat. Each front slide rail mounting bolt should have 1) **2720975-07** 3/8" Spacer and 1) **2720975-06** 5/8" Spacer. It may also require that you change the front slide mounting bolt to a longer **64123-69** Bolt. Each rear slide rail mounting bolt should have 1) **2720975-07** 3/8" Spacer. Existing bolts will work in the rear mounts.

It may be necessary to loosen the top Slide Rail to Seat mounting bolts to assist in aligning the bottom Slide Rail to Mounting Plate bolts. After tighten the Seat to the Mounting Plate, retighten the top bolts using a boxend wrench.

#### **Effective Serial Number**

All 942220, 942221, 942222, 942223, 942224, 942225, and 942226 units.

#### **Warranty**

You may claim up to 15 minutes labor and parts for units within the normal warranty period. Please file warranty in the normal manner with one unit per claim.

#### **Parts Involved**

- 4) 2720975-07 3/8" Spacer.
- 2) 2720975-06 5/8" Spacer.
- 2) 64123-69 Bolt.

If you have any questions about this bulletin, please contact the Textron Golf, Turf And Specialty Products Service Department at 920-699-5890.