



Bob-Cat

Service Bulletin 388

Product Type: Midsize

Ref. No. 002

October 1998

Kawasaki FH500V Fan Housing Screen

Midsize Models Affected: 930007, 930307

Issue

Under certain operating conditions, grass may accumulate on the rotating screen. If the screen is not cleaned from time to time, it will block the cooling airflow to the engine. This problem occurs only on the recoil starter versions.

Correction

Replace existing rotating screen with a new steel rotating screen (Kawasaki #14037-7006-9H) as per attachments.

Effective Serial Number

Kawasaki Engine Models:

MODEL	SPECIFICATION	ELIGIBLE ENGINE NO. RANGES
FH500V	AS03	BEFORE VA09707
FH500V	AS08	BEFORE VA09792

Warranty

Warranty claims for parts and up to 0.3 hrs of labor may be submitted through your local Kawasaki Dealer. See attachments for further instructions.


Attachments

Installation instructions.
Warranty instructions.


If you have any questions about this bulletin, please contact the Textron Turf Care and Specialty Products Service Department at 920-699-2000.

Installation Instructions


1. Remove the recoil starter case by unscrewing the nuts (4 pcs.).
 * The studs which come out of the fan housing may also be loose. If so, hold the studs with a wrench and remove only the nuts on the recoil starter case.
2. Remove the fan housing by unscrewing the bolts (4 pcs.).
3. Remove the starter pulley by unscrewing the nut.
4. Remove the plastic screen.
5. Clean debris for the cylinder, cylinder head fins and engine shroud.
6. Install the new metal screen (New Part No. 14037-7006-9H).
 * Make sure that tabs on the screen and slots on the fan match together

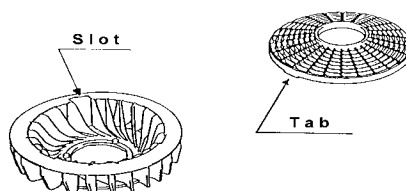

7. Install the pulley.
 * Make sure that the notches on the plate go into the holes on the pulley.

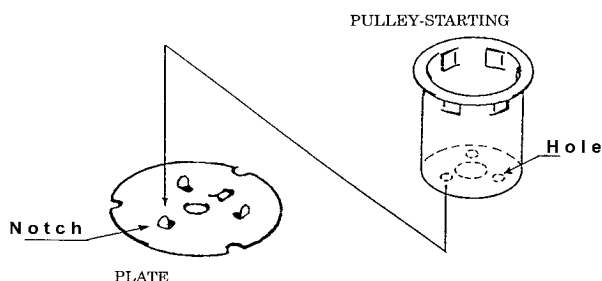

- * Make sure that the direction of the washer is correct.

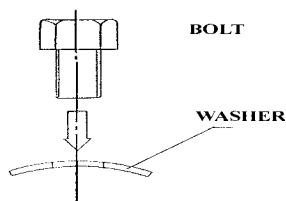

- * Torque the bolt to 40 ft/lbs.
8. Install the recoil starter case.

Note:

This repair procedure can also be found in your Kawasaki Engine Service Manual (P/N. 99924-2045-01).

See pages: 7-23 for recoil starter removal and installation procedures.
7-11 and 7-12 for screen removal and installation.

Warranty Information

When submitting the warranty claim form (P/N 99969-04958 Rev 1-98) for this service bulletin, please include the following information.

1. Under - Authorization for no charge transaction, Special letter, enter AD1960L.
2. Under - Parts replaced.
Part number, enter 14037-7002. Part name, enter Screen. Qty., enter 0.
Part number, enter 14037-7006-9H. Part name, enter New screen. Qty., enter 1.

3. Under - Labor, Time in tenth of hours, enter 0.3 hrs.

4. Under - Use this space for remarks or special data required by the factory, enter Trouble code 62 and Claim type 3.