

Bunton

Product Type: BZT2000 Ref. No. 003 Product Type: BZT3310 Ref. No. 001

Service Bulletin J446Rev01

May 2000

Caster Wheel Bearing

Models Affected: 655202, 656102, 642300

Issue

We have changed to a larger diameter caster wheel bearing to improve the load carrying capabilities of the wheel. Please note the instructions below when ordering replacement parts.

Correction

Service existing 2188123-02 (rim only) with **2720475-02** (rim) and **2720474** (spacer). The existing 2188123-04 old spacer will still need to be used and should be ground slightly so that it is shorter than the new spacer **2720474**. This is required so that when the wheel bolt is tightened, the yoke is clamping the new spacer and not clamping on the old spacer. To assemble the wheel into the yolk, slide the new spacer **2720474** over the ground old spacer 2188123-04. Then slide the wheel over both spacers and install into the yolk with the existing 1/2" wheel bolt. Once the wheel is assembled in the yolk with both spacers and the caster wheel bolt is tightened, check to insure that new spacer does not rotate when the wheel is rotated.

Service existing 2188123-01 (tire only) with **2720475-01** (smooth tire).

Service existing 2186123 and 2186123.7 (yoke) with **2720545.7** (yoke), **2720475** (wheel and hub), **2720474** (spacer), **64123-215** (bolt) and **64229-07** (nut). This replaces existing yokes with the new yoke. It will require that you replace the wheel and hub assemble. The new yoke has a larger through bolt that will not allow use with the old style hub.

Effective Serial Number

All 655202, 656102 and 642300 decks.

Warranty

This bulletin is for informational purposes only. Warranty does not apply.

Parts Involved

2720475-02 Rim & 2720474 Spacer. 2720475-01 Tire.

2720545.7 Yoke, 2720475 Wheel and Hub, 2720474 Spacer, 64123-215 Bolt & 64229-07 Nut.

If you have any questions about this bulletin, please contact the Textron Turf Care And Specialty products Service Department at 920-699-5890.