

November 2000

### New Wiring Harness

#### Models Affected: All BZT2000's

#### Issue

We have released a New Wiring Harness **2721375** and Relay Mount **2721319.7** for all the BZT2000 units.

#### Correction

When replacing a 2188213 harness, you must order a **2721375** harness and a **2721319.7** relay mount. The new harness requires that you re-route it across the top of the frame above the battery and then drop it down along the left-side of the battery (Dwg.1). You will have to install the new relay mount 90 degrees clockwise from the previous location and an additional hole must be drilled in the engine deck (Dwg.2). The new relay mount will also allow for the time delay to be mounted on it.

#### Effective Serial Number


All BZT2000's.

#### Warranty

This bulletin is for informational purposes only. Warranty does not apply.


#### Parts Involved

2188213 Harness.  
2721375 Harness.  
2721319.7 Relay Mount.

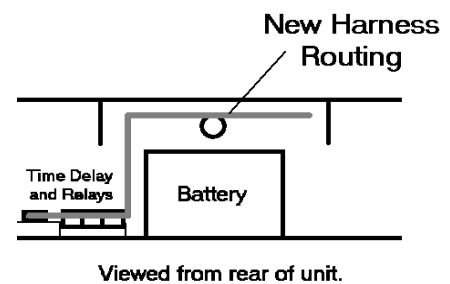

Viewed from rear of unit.

Dwg.1

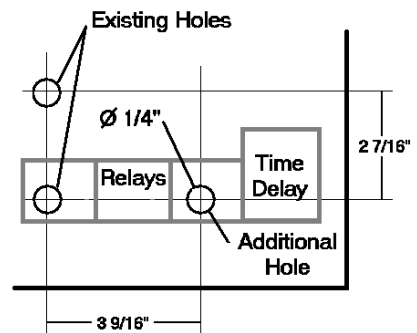

Viewed from Top Left Front of Unit

Dwg.2

If you have any questions about this bulletin, please contact the Textron Golf, Turf & Specialty Products Service Department at 920-699-5890.