

February 2003

## Transport Axle Lifting Spring

### Models Affected: All Lawnaire IV and V's

#### Issue

We have found that in certain conditions the **Lift Transport Springs 4113746** may come off.

#### Correction

You will have to install 2 - **64163-29 Flat Washers**, 1 on each side of the spring and replace the existing bolt with a **64123-47 Bolt**. Fig 1 below.

#### Effective Serial Number

All Lawnaire IV and V's.

#### Warranty

Please file claims in the normal matter with one unit per claim. You may claim parts and up to .2 hours of labor for each unit that is within the warranty period.

#### Parts Involved

64163-29 FW  
64123-47 Bolt  
4113746 Spring

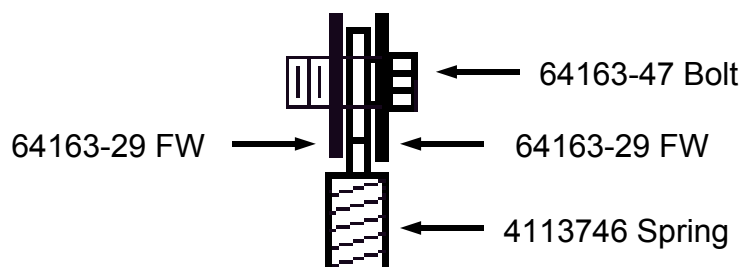


Fig 1.

If you have any questions about this bulletin, please contact the Textron Turf Care And Specialty Products Service Department at 920-699-5890.