



*One BOB-CAT Lane
P.O. Box 469
Johnson Creek, WI 53038-0469*

*Phone: 920.699.2000
Fax: 920.699.2657*

Product Type: Steiner 430

Bulletin No: JC-022-07

October 22, 2007

Service Bulletin

Action Required: Removal of engine from the tractor and new driveshaft installed.

ISSUE: Upgrade driveshaft.

(Driveshaft shipped to dealer, No charge as per serial number records)

CORRECTION: Remove engine from the tractor. Then remove the coupler #2 from the pump shaft and remove the driveshaft from the engine and discard it, retain the hardware for reassembly. Enlarge the hole in the center of the engine flywheel screen #29 to a 2.88 diameter hole (see schematic). Now install the new driveshaft #30 onto the engine using the hardware removed when disassembling. Ensure the flywheel fins and clamp stay centered on the flywheel. Reassemble engine into tractor.

PARTS INVOLVED:

- 1 – 4162858 DRIVESHAFT, #30 in drawing
- 1 – 64123-87 BOLT-HEX 3/8-16X1-3/4, #31 in drawing
- 1 – 64229-03 NUT LOCKNUT-NYLON 3/8-16, #32 in drawing

PRODUCTS INVOLVED: 430-33G 75-70010A

Serial number range: 75700100070 – 7570010152 excluding 75700100146

If you received any of these tractors you are responsible to see that they get changed.

WARRANTY:

You may claim up to 3.5 hours of labor and parts for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-022-07 with one unit per claim.

All warranty claims regarding this bulletin must be filed before April 22, 2008

If you have any questions please contact Commercial Grounds Care Inc.
Customer Service Department @ 920-699-2000

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

	<input checked="" type="checkbox"/>		<input checked="" type="checkbox"/>		<input checked="" type="checkbox"/>		<input checked="" type="checkbox"/>
SERVICE		WARRANTY		SALES		PARTS	



CGC

Commercial Grounds Care, Inc.

*One BOB-CAT Lane
P.O. Box 469
Johnson Creek, WI 53038-0469*

Phone: 920.699.2000

Fax: 920.699.2657

