

One BOB-CAT Lane, P.O. Box 469 Johnson Creek, WI 53038 U.S.A. (920) 699 2000

Fax: (920) 699 6836

# **Service Bulletin**

Date: 07/23/2015

Bulletin No: JC-15-10

**Product Type: STEINER 440** 

#### **Customer Issue:**

- 1. Premature wear of neutralizer components (bolt, spring, rod end), possible failure of these components
- 2. If the neutralizer components fail, the tractor is still operable thru the use of the foot pedal

#### Cause:

- 1. Vibration from the drive pump being transferred thru the pump bracket to the neutralizer components
- 2. This issue affects tractors with the pump bracket supplied in the 970485A and 970508 kit or built at the factory (see serial number list below)

## **Action required:**

Order the new 970534 or 970535 kits and install them.

- **Kit 970534 F/R CABLE** replaces kits 970485, 970485A. If the tractor has **no** forward and reverse cable update installed, you will need to get this kit.
- **Kit 970535 PUMP LVR ASSY** replaces kit 970508. If the tractor has any of these three kits installed, 970485, 970485A or 970508, you will need to get this kit.
- Note: There is no need to discard any 970485 or 970485A kits in stock. Order kit 970535 to match the quantity of 970485 or 970485A kits in inventory. This will make them up-to-date kits.

## **Products Involved:**

440 tractors up to serial numbers:

# 75720100711 440 Kubota diesel

 These tractors have already been updated at the factory: 75720100490, 75720100704, 75720100705, 75720100706, 75720100707, 75720100708, 75720100710, 75720100112, 75720100114, 75720100117, 75720100249, 75720100250, 75720100319, 75720100689, 75720100691, 75720100693, 75720100694, 75720100695, 75720100698, 75720100700, 75720100701, 75720100703, 75720100709



One BOB-CAT Lane, P.O. Box 469 Johnson Creek, WI 53038 U.S.A. (920) 699 2000 Fax: (920) 699 6836

7572011<mark>0331</mark> 440 Kubota gas

 These tractors have already been updated at the factory: 75720110326, 75720110327, 75720110329, 75720110330

75720120322 440 Kohler 34 HP.

 These tractors have already been updated at the factory: 75720120201, 75720120318, 75720120319, 75720120320, 75720120321

75720130325 440 Kohler 40 HP.

 These tractors have already been updated at the factory: 75720130151, 75720130322, 75720130323, 75720130324

**Warranty:** Warranty applies. Please use the service bulletin labor code **JC-15-10**.

- You may claim 4 hours labor for kit 970534 JC-15-10A
- You may claim an extra 2 hours. labor for kit 970534 on tractors with cabs JC-15-10B
- You may claim 1.5 hours labor for 970535 JC-15-10C
- For tractors updated before **August 31, 2015,** you may add an additional \$150 admin fee.
- For tractors updated between <u>September 1, 2015</u> and <u>October 31, 2015</u>, you may add an additional \$50 admin fee.

If you have any questions, please contact our Customer Service Department at 920-699-2000. This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE	WARRANTY	SALES	PARTS
X	X		X