



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

Service Bulletin

Date: 4/20/15

Bulletin No: JC-15-08

Product Type: STEINER 440

Customer Issue:

440 Kubota-gas tractors, ignition coil wires break.

Cause:

The original coil mount (4166761.7) can transmit vibration. This vibration could result in the ignition coil wire fatiguing and breaking.

Action required:

Order from the Parts Department and install the new coil mount **4171061.7**.

Products Involved:

Coil mount applies to 440 Kubota gas tractors 75-72011 up to and including serial number 75720110316

Warranty: This is not a recall. Fix-as-Fails as this will not affect all units.

Regular warranty procedures apply:

Flat rate is set @ .5 hours of labor for installation of coil bracket kit **4171061.7**.

Please file warranty using (drop-down box) labor code **JC-15-08 for Coil Bracket** with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE

☒

WARRANTY

☒

SALES

☐

PARTS

☒