



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

SERVICE BULLETIN

Date: June 24, 2013

Bulletin No: JC-13-18

Product Type: STEINER


Customer Issue: The valve on the end of the Kubota engine oil drain hose can be removed too easily and cause a possible oil loss.

Cause: There is no hose clamp to hold the valve tight in the hose.

Action required: Install a hose clamp on the engine oil drain hose.

7572010 Kubota diesel tractors order a hose clamp: 88042-05

7572011 Kubota gas tractors order a hose clamp: 88042-03

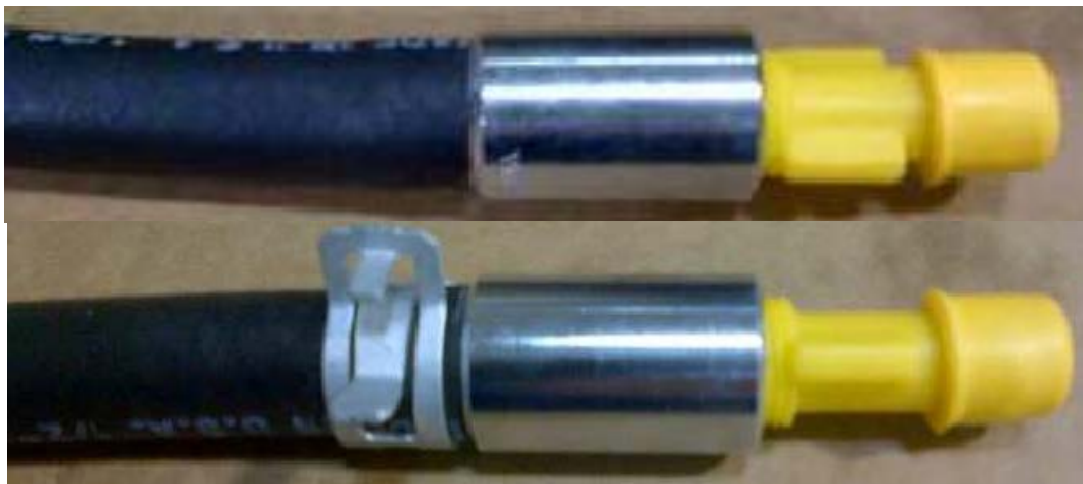

Products Involved: 440 Kubota powered tractors: 75-72010 and 75-72011.

7572010 Serial numbers: all tractors up to 75720100344

7572011 Serial numbers: all tractors up to 75720110199

Warranty: You may claim up to .10 hour of labor for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-13-18 with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE



WARRANTY



SALES



PARTS

