

Service Bulletin

Date: 01/10/2007

Product Type: Bunton Z Control (Hydro)

Bulletin No: JC-002-07

2721246 Dampener

ISSUE:

We have received reports; there is not enough dampening in the steering controls.

CORRECTION:

Replace dampeners 2721246 with 2228065.

Rework pump arm bracket by scribing a line between the two existing holes, measure over from the left hole (center to center) .35 inches and drill a 5/16" hole.



PARTS INVOLVED:

2721246 and 2228065

PRODUCTS INVOLVED:

630325, 630326 and 630329

WARRANTY:

You may claim up to .5 hour of labor and parts for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-002-07 with one unit per claim. If you have any questions please contact Commercial Grounds Care Inc. Customer Service Department @ 920-699-2000

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒

