

SERVICE BULLETIN

Date: April 26, 2011


Bulletin No: JC-005-11

Hydraulic Oil Level

Issue: Hydraulic whining on new G series ProCat and Predator-Pro (separate pump & wheel motor units).

Cause: Oil level in hydraulic reservoir on some early production models was low. We have found in our assembly process that the hydraulic system was not being filled or topped off at the recommended level. We have implemented appropriate practice in assembly to ensure the proper oil level is reached.

Action Required: During the setup process please check the oil level and if needed, fill to the recommended level, which is just below the bottom of the fill tube.

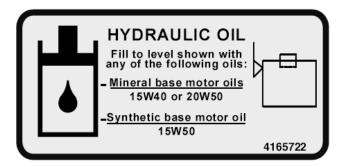

<u>NOTE:</u> This larger tank makes it look like you are near the fill tube when in reality you are 1-2 quarts low. The capacity of the complete dry system is 8 quarts. <u>The capacity of just the tank for an oil change is 5.5 to 5.75 quarts.</u>

Products involved:

MODEL	DESCRIPTION	UP TO SERIAL
942500G	BC PROCAT 22HP KAW W/52 SD	00365
942501G	BC PROCAT 26HP KAW W/52 SD	00179
942502G	BC PROCAT 26HP KAW W/61 SD	00354
942504G	BC PROCAT 29HP KAW W/61 SD	00379
942505G	BC PROCAT 27HP KOH W/61 SD	00191
942506G	BC PROCAT 29HP KAW W/52 SD	00144
942507G	BC PROCAT 29HP KAW W/61 RD	00074
942508G	BC PROCAT 29HP KAW W/72 SD	00151
942509G	BC PREDPRO 30HP GEN LP W/61 SD	00070
942512G	BC PREDPRO 33HP GEN W/61 SD	00111

Make Your Move™



Page 2 of 2

MODEL	DESCRIPTION	UP TO SERIAL
942514G	BC PREDPRO 34HP KAW W/61 SD	00287
942515G	BC PREDPRO 37HPDFI KAW W/61 SD	00189
942516G	BC PREDPRO 37HPDFI KAW W/72 SD	00140
942518G	BC PREDPRO 30HP KOH W/72 SD	00081

Warranty: Oil level check for the engine and hydraulics is a normal part of set-up and routine service. However; if you find the system takes a quart or two to bring it up to full, we will compensate for the additional oil. File a <u>Labor Only</u> claim using WarrantySmart and select "JC-005-11" from the labor drop down box. This will allow .2hrs which should be more than enough to cover any oil that may have been required (do not enter oil as a separate entry on the claim). "Admin Fee" will <u>not</u> apply. Note: These units are shipped with 15W40 mineral base oil in them. You do not need to add Synthetic oil.

If you have any questions, please contact the Schiller Grounds Care Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE	WARRANTY	SALES	PARTS
X	X	X	