

SERVICE BULLETIN

Date: April 5, 2012

Bulletin No: JC-005-12

Product Type: Walk-Behind

Customer Issue: Clutch fails to engage on BOB-CAT & Bunton Walk-Behind mowers.

Cause: Premature failure of interlock switch 108208. The power for the clutch runs through the interlock switch. If the interlock switch is not completely depressed, it causes arching and heat across the switch contacts which leads to premature failure. The installation of a relay provides for a positive on/off electrical connection to the clutch.

Action Required: Due to the nature of the issue, this is not a rework of all units but rather a "fix as fail" basis. Install clutch relay kit **970432** for units with wire harness 4131438 that experience interlock switch failure during the warranty period. See Instruction Sheet 4167242 Rev A (enclosed).

BOB-CAT and Bunton Products Involved:

<u>630322A</u>	<u>630323A</u>	<u>630328A</u>	<u>632006</u>	<u>633006</u>	<u>633010A</u>
<u>633301</u>	<u>633330</u>	<u>634006</u>	<u>634010A</u>	<u>634301</u>	<u>634330</u>
<u>635301</u>	<u>635330</u>	<u>930322A</u>	<u>930323A</u>	<u>930324A</u>	<u>930328A</u>
<u>932006</u>	<u>932007</u>	<u>932007G</u>	<u>933006</u>	<u>933007</u>	<u>933007G</u>
<u>933301</u>	<u>933302</u>	<u>933305</u>	<u>933305G</u>	<u>933307</u>	<u>933307G</u>
<u>933330</u>	<u>933331</u>	<u>933331G</u>	<u>934006</u>	<u>934007</u>	<u>934007G</u>
<u>934301</u>	<u>934302</u>	<u>934306</u>	<u>934306G</u>	<u>934307</u>	<u>934307G</u>
<u>934330</u>	<u>934332</u>	<u>934332G</u>	<u>935301</u>	<u>935302</u>	<u>935308</u>
<u>935308G</u>	<u>935309</u>	<u>935309G</u>	<u>935330</u>	<u>935333</u>	<u>935333G</u>

Warranty: You may claim up to **.4** hour of labor and parts for units covered under this bulletin. Please file using WarrantySmart drop down labor code JC-005-12 with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

