



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

SERVICE BULLETIN

September 14, 2010

Bulletin No: JC-015-10

Product Type: FASTCAT PRO & RZ

Issue: The mounting bolt that holds the clutch to the crankshaft may have been tightened improperly from the factory. FASTCAT units in the specified serial number range below need to be checked for this issue.

Action Required: Disconnect battery cables. Then mark the crankshaft bolt in relation to the drive spacer. While not allowing the drive spacer to turn, torque the bolt to the required 55 ft. lbs. Finally, reconnect the battery. On the claim, please document if the bolt was loose or set properly.



Products Involved:

Model Number	Serial Number Range
942291F FASTCAT PRO 17HP KAW KAI 36	02114 thru 02137
942297F FASTCAT PRO 18HP KAW FX	00072 thru 00073
942298F FASTCAT PRO 20HP KAW KAI 48	00290 thru 00404
942299F FASTCAT PRO 22HP KAW KAI 52	00194 thru 00314
942302F FASTCAT PRO 20HP KAW FX 42	00103 thru 00120
942311F FASTCAT RZ 22HP B&S ELS	00234 thru 00266
942313F FASTCAT RZ 26HP B&S ELS	00545 thru 00614
942404F FASTCAT PRO 23HP B&S VGD	00444 thru 00469
942405F FASTCAT PRO 24HP KAW FX	00176 thru 00237

Warranty: You may claim up .3 tenths of an hour labor for units covered under this bulletin. To file warranty, select JC-015-10 from the labor code drop down labor box.

If you have any questions please contact Schiller Grounds Care, Inc. Customer Service Department @ 920-699-2000

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE



WARRANTY



SALES



PARTS



Exactly What You Need