

One BOB-CAT Lane, P.O. Box 469 Johnson Creek, WI 53038 U.S.A. (920) 699 2000

Fax: (920) 699 6836

Service Bulletin


October 8, 2010

Bulletin No: JC-016-10

Issue: Engine shuts down immediately and will not restart

Cause: Wiring harnesses were manufactured without the required boot over the female spade on the (purple) wire to the carburetor solenoid. This exposed connection can touch ground, blowing the fuse on the charge circuit (purple wire fuse holder). The solenoid then shuts off all fuel supply to the engine causing unit to shut down, and not re-start.

Action Required: Pull the wire apart at the connection, slip a 2 inch piece of heat shrink tubing over the wire, reconnect the wire, slide the heat shrink tubing over the connection and heat it to shrink it in place. Replace fuse.

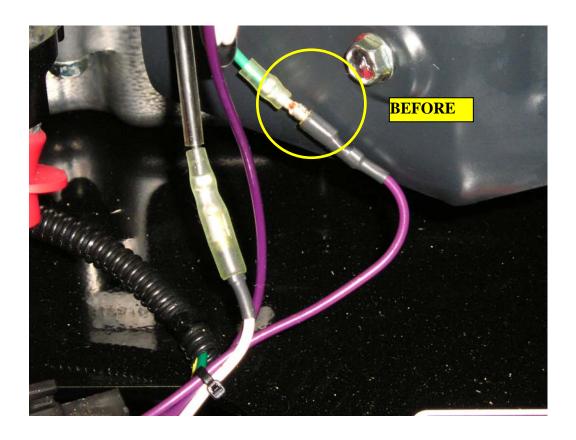




One BOB-CAT Lane, P.O. Box 469 Johnson Creek, WI 53038 U.S.A. (920) 699 2000

Fax: (920) 699 6836

Page 2 of 2

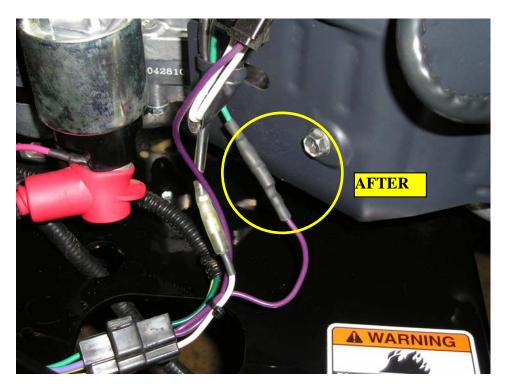

Products Involved: FastCat & Full Size ZT2 units with Kawasaki Engines manufactured between the dates of 02-01-2010 and 08-19-2010. A detailed list of models & affected serial numbers are as follows:

Model	Serial Range
942246F	00719-00877
942249F	00137-00871
942250F	00104-00514
942251F	00106-00239
942252F	00112-00365
942253F	00120-00182
942254F	00146-00608

Model	Serial Range
942257F	00073-00296
942258F	00107-00203
942259F	00128-00217
942297F	00073-00103
942298F	00167-00818
942302F	00103-00160
942405F	00143-00423

Warranty: You may claim up to .2 hour of labor for units covered under this bulletin. Please file warranty using code JC-016-10 from the labor drop down box in WarrantySmart with one unit per claim.

If you have any questions please contact Schiller Grounds Care Inc. Customer Service Department @ 920-699-2000

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE	WARRANTY	SALES	PARTS
X	X		