

---

## **Service Bulletin**

**Date: 7/16/2008**

**Product Type: FastCat & Rocket**

**Bulletin No: JC-017-08**

### **PTO Idler Belt Guide**

**ISSUE:** We have received reports of the belt jumping off on 48" Fastcat & Rocket units when the cutting height is set very low. To date no reports have been received of this occurring on the 52" units but the idler arrangement is the same. Therefore if it you experience it on a 52" unit, this bulletin would be applicable. This is a rare occurrence that appears to be isolated to southern markets where cutting heights are 2" or less.

**CORRECTION:** Any unit described above that experiences this symptom needs to install belt guide 4163514.7 on the PTO idler pulley. To prevent any possibility of this occurring in the future, we will install this part on all 48' & 52" units manufactured after 7-11-2008.

**ACTION REQUIRED:** This does **NOT** occur on all units and is **NOT** a recall. If a customer experiences this situation then installation of the belt guide is applicable.

**PART INVOLVED:** 4163514.7 – Instructions follow.

**PRODUCTS INVOLVED:** 48" & 52" BOBCAT Fastcat AND 48" & 52" BUNTON Rocket Zero Turn Units.


**WARRANTY:** .5 hour **ONLY** on as need basis.

If you have any questions please contact Commercial Grounds Care, Inc.  
Customer Service Department @ 920-699-2000

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒



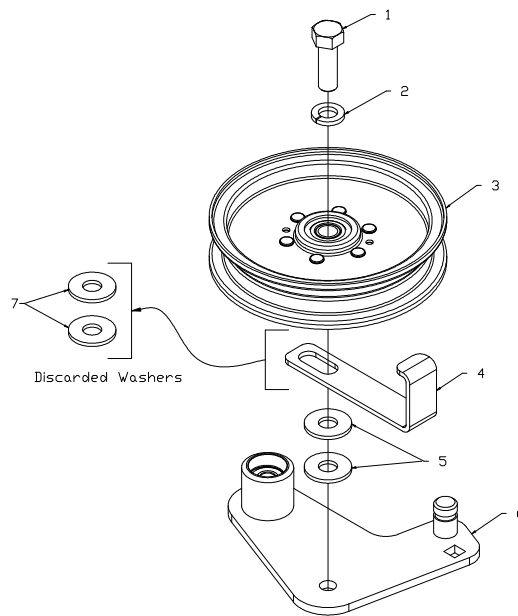

Instructions for installing belt Guide:

- 1.) Disassemble idler assembly by removing bolt **1**.
- 2.) Remove and discard (2) washers **7**.
- 3.) Re-assemble idler by replacing discarded washers **7** with belt guide **4**.
- 4.) Position belt guide **4** parallel to rear of cutterdeck as shown in photo.
- 5.) Retighten bolt **1**.

