



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

Service Bulletin


October 27, 2010

Bulletin No: JC-020-10

Issue: One of the steering hoses on the 235 could get damaged.

Cause: If both hoses are not tied properly to each other, one hose could fall out between the frame and axle and get pinched when driving over uneven ground.

Action required: Tie both hoses together with tie straps to assure the hose cannot get pinched.

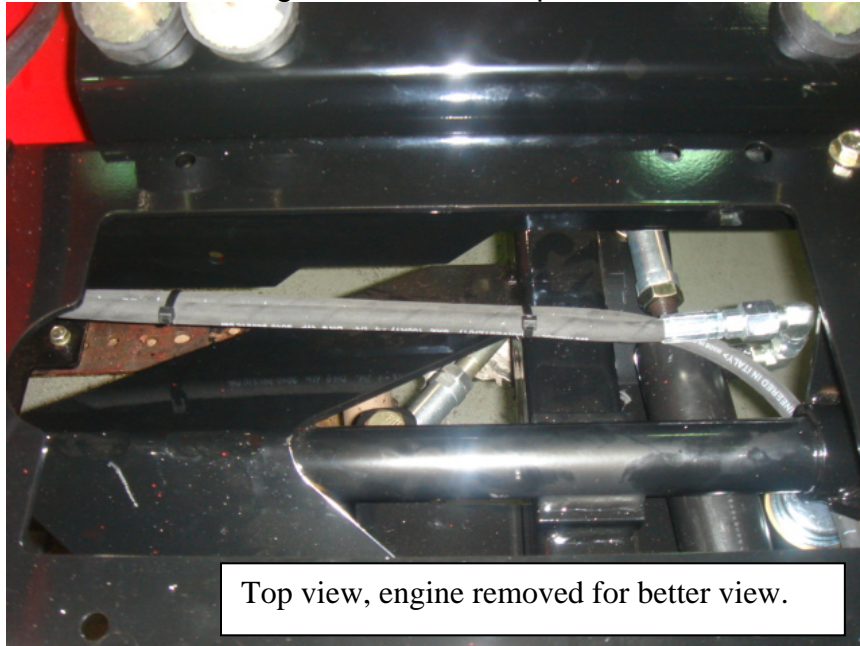

Products Involved: 75-70282, 235 Serial numbers: 75702820071 - 75702820126

Warranty: You may claim up to .50 hour of labor and parts for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-020-10 with one unit per claim.

If you have any questions, please contact Schiller Grounds Care's Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE



WARRANTY



SALES



PARTS



MOW IT ► BLOW IT ► TRENCH IT ► HAUL IT ► DRILL IT ► TILL IT ► **DO IT.**