



One BOB-CAT Lane, P.O. Box 469  
Johnson Creek, WI 53038 U.S.A.  
(920) 699 2000  
Fax: (920) 699 6836

## SERVICE BULLETIN

**Date:** June 24, 2013

**Bulletin No:** JC-13-18

**Product Type:** STEINER


**Customer Issue:** The valve on the end of the Kubota engine oil drain hose can be removed too easily and cause a possible oil loss.

**Cause:** There is no hose clamp to hold the valve tight in the hose.

**Action required:** Install a hose clamp on the engine oil drain hose.

7572010 Kubota diesel tractors order a hose clamp: 88042-05

7572011 Kubota gas tractors order a hose clamp: 88042-03

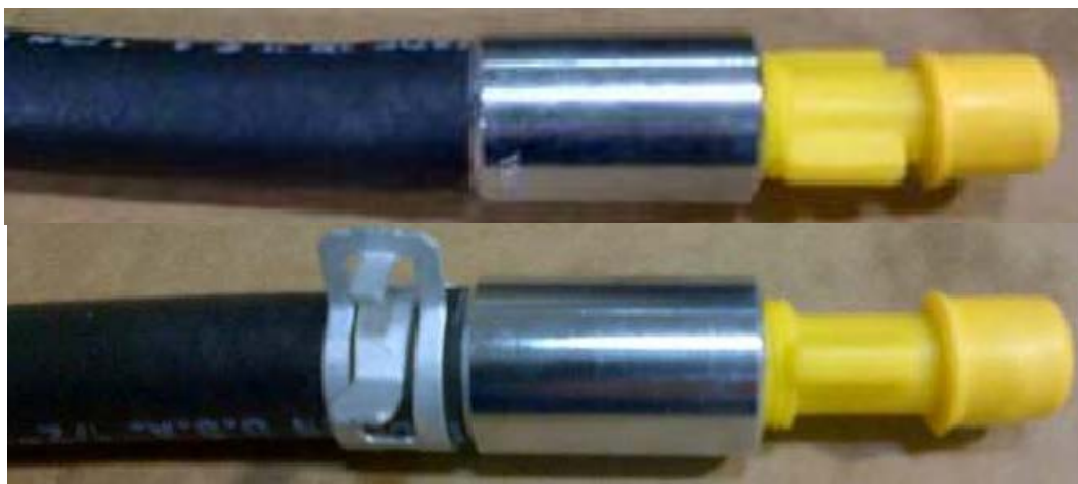

**Products Involved:** 440 Kubota powered tractors: 75-72010 and 75-72011.

7572010 Serial numbers: all tractors up to 75720100344

7572011 Serial numbers: all tractors up to 75720110199

**Warranty:** You may claim up to .10 hour of labor for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-13-18 with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE



WARRANTY



SALES



PARTS



MOW IT ► BLOW IT ► TRENCH IT ► HAUL IT ► DRILL IT ► TILL IT ► **DO IT.**

**DO IT.**