



Jacobsen Information Bulletin

Product Type: Jr. Sodcutter

Ref. No. N/A

Bulletin No: C-037-05

August 8, 2005

Rear Wheel Spacer


Product Information

ISSUE:

Rear Wheel not being held in place, allowing the bearing to be damaged.

CORRECTION:

Install 1 –2 spacers part number 64163-67 per side as shown in drawing, to shim rear wheel to forks within a 1/8" of play. Try to center wheel in between forks as much as possible.

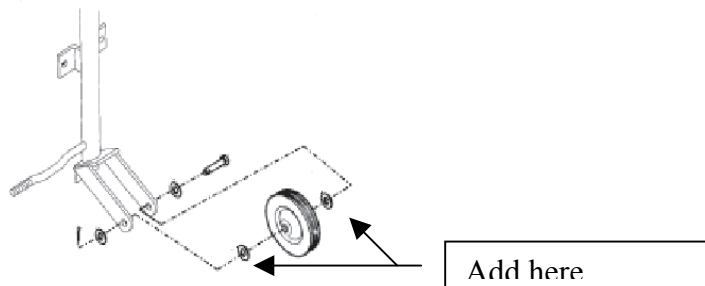

PARTS INVOLVED:

64163-67

INVOLVED PRODUCTS:

744944A

744844D

744945A

744845D

WARRANTY:

This bulletin is for information purposes only. Warranty does not apply. If you have any questions please contact the Jacobsen Product Support Team at 1-800-848-1636 option 2,3,1.

CustomerOne™ Product Support

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE



WARRANTY



SALES



PARTS

