

# Bobcat/Bunton Information Bulletin

**Product Type: ZT2 Series/BZT2 Series**

**Ref. No. 003**

**Bulletin No: C-010-04**

**March 12, 2004**

## **Kawasaki FH680V/FH721V Remote Engine Air Filter**

### **Product Information**

#### **ISSUE:**

Kawasaki Motors Corp., U.S.A. has found that the intake elbow on model FH vertical shaft engines equipped with the canister air filter kit may be warped.

#### **CORRECTION:**

Follow instructions on the attached Kawasaki bulletin.

#### **PARTS INVOLVED:**

FH680V and FH721V Engines

#### **INVOLVED PRODUCTS:**

Model 642222	Serial numbers 64222203002 up to and including 64222203010
Model 642223	Serial numbers 64222300367 up to and including 64222300377
Model 642233	Serial numbers 64223300531 up to and including 64223300535
Model 642222A	Serial numbers 64222203212 up to and including 64222203253
Model 642223A	Serial numbers 64222300578 up to and including 64222300580 64222303001 up to and including 64222303100
Model 642233A	Serial numbers 64223300736 up to and including 64223300755 64223303002 up to and including 64223303063
Model 942222	Serial numbers 94222203031 up to and including 94222203088
Model 942223	Serial numbers 94222301870 up to and including 94222301994
Model 942233	Serial numbers 94223300070 up to and including 94223300213
Model 942222A	Serial numbers 94222203289 up to and including 94222203520
Model 942223A	Serial numbers 94222302195 up to and including 94222303691
Model 942233A	Serial numbers 94223300414 up to and including 94223300459 94223303001 up to and including 94223303598

**WARRANTY:**

This bulletin is for informational purposes only. Please contact Kawasaki Motors Corp., U.S.A. with questions at 1-866-836-4463.

**CustomerOne™ Product Support**

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒

### Heavy Duty Canister Air Filter Intake Pipe Modification (FH 601V, 641V, 680V, 721V)

Jan. 12, 2003

#### Subject

Sealing area between the intake pipe and carburetor is deformed.

#### Kawasaki Action


Kawasaki has reinforced the intake pipe and added a bead on the gasket. Kawasaki has also reworked engines in inventory and initiated a Factory Directed Modification (FDM) campaign to repair eligible field units. Each machine manufacture will notify end users of this campaign and direct them to an authorized dealer for repair.

#### Eligibility

##### Eligible Units

Model	Eligibility	Serial number Range
FH601V	Any engine that has Heavy Duty Canister Air Filter installed.	Before B55460
FH641V		Before B16642
FH680V		Before B28625
FH721V		Before B25280

Engines in the above serial numbers range are eligible. Engines with a white dot painted on the **breather hose**, have been reworked before shipping to dealers and are not eligible for this repair even if they are in the above range.

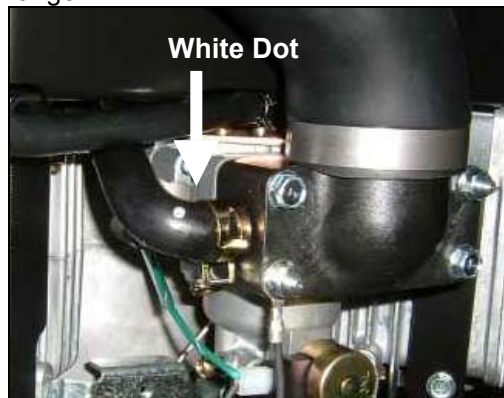


#### Dealer Action

##### Repair Eligible Units:

Repair all eligible units that have a heavy-duty canister air filter by installing a new reinforced plastic intake pipe and beaded gasket.

**Bolt Torque Specs: 4.3-5.7 ft/lbs.**

**Make sure to follow bolt torque pattern.**

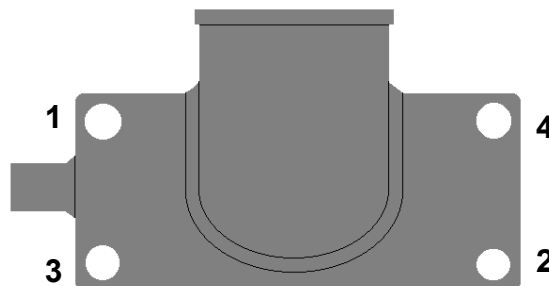

#### Parts Information

Kawasaki has created a repair kit for this campaign, so please order them as required through the normal parts ordering system.


Part Name	Part Number
Kit	99999-7038
Parts Contained	Intake Pipe
	Gasket

Kit contains intake pipe and beaded gasket.

##### Old Parts



##### New Parts

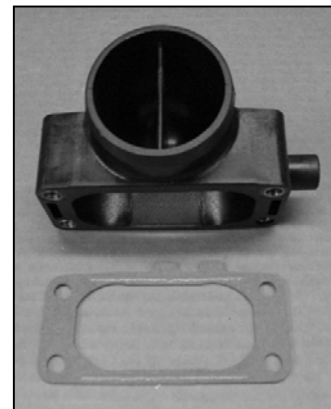

Gasket should be installed with the tab down.

---

## Warranty Information

---

This is a Factory Directed Modification (FDM). The labor and parts costs will be reimbursed upon your warranty claim request.

Models	FH 601V, 641V, 680V, 721V
Flat Rate Time	.5 hrs.
Causal Part	Intake Pipe
Causal Part No.	16060-7005
Qty	1
Labor Code	2306
Claim Type	3

---

## Spare Parts

---

Some dealers may have Heavy Duty Canister Accessory Kits in their parts inventory. These kits may have the old intake elbow and gasket and need to have the parts replaced inside the kit. Kawasaki will replace the parts at no charge.

Dealers will need to call the Kawasaki Technical Hotline (866-836-4463) and give the quantity of kits they will need. The hotline will then send the kits out UPS ground to the dealer.

Kits or individual parts that need to have intake & gasket changed.	
Description	Part Number
Canister Kit	99999-7007
Canister Kit	99999-7008
Canister Kit	99999-7010
Canister Kit	99999-7011
Canister Kit	99999-7012
Intake	16060-7005
Gasket	11060-7009