



Bulletin No: SB2004-14

Category: STEINER

Section: N/A

Index Ref: N/A

Machine/s: Model 430

Pages: 4

Date: November 1, 2004

Type: Product Information

TO: All Steiner Dealers

SUBJECT: Kohler muffler

ISSUE:

Kohler muffler replacement.

CORRECTION:

When ordering part number 13-071 for a replacement on model 75-70005 you have two options.

- 1) Order 4132729 muffler, 64205-013 M6-1 x 12 Bolt, 64006-01 ¼ " lock washer and 60-579.17 grille.
- 2) Order 4132729 muffler, 64205-013 M6-1 x 12 Bolt, 64006-01 ¼ " lock washer and use the template in figure 1, to add the hole in the grille for the exhaust tube.

When muffler is installed route the headlight wires as the picture shows in figure 2. You will also need to use quantity of 2 wire ties to keep the headlight wiring away from the muffler.

If the unit is equipped with weight transfer kit 70-174, the left hand mount part number 64-1001.7 needs either to be reordered to get an updated part or it can be reworked to as shown in figure 3, to allow it to fit.

AFFECTED SERIAL NUMBERS:

Model 75-70005 serial numbers prior to 75700050329

WARRANTY:

This bulletin is for information purposes only. Warranty does not apply. If you have any questions please contact the Jacobsen product support team at 1-800-848-1636 option 3,2.

CustomerOne™ Product Support

This bulletin is relevant to the departments shown below. Please circulate as appropriate.

SERVICE ☒ WARRANTY ☒ SALES ☐ PARTS ☒

Figure 1

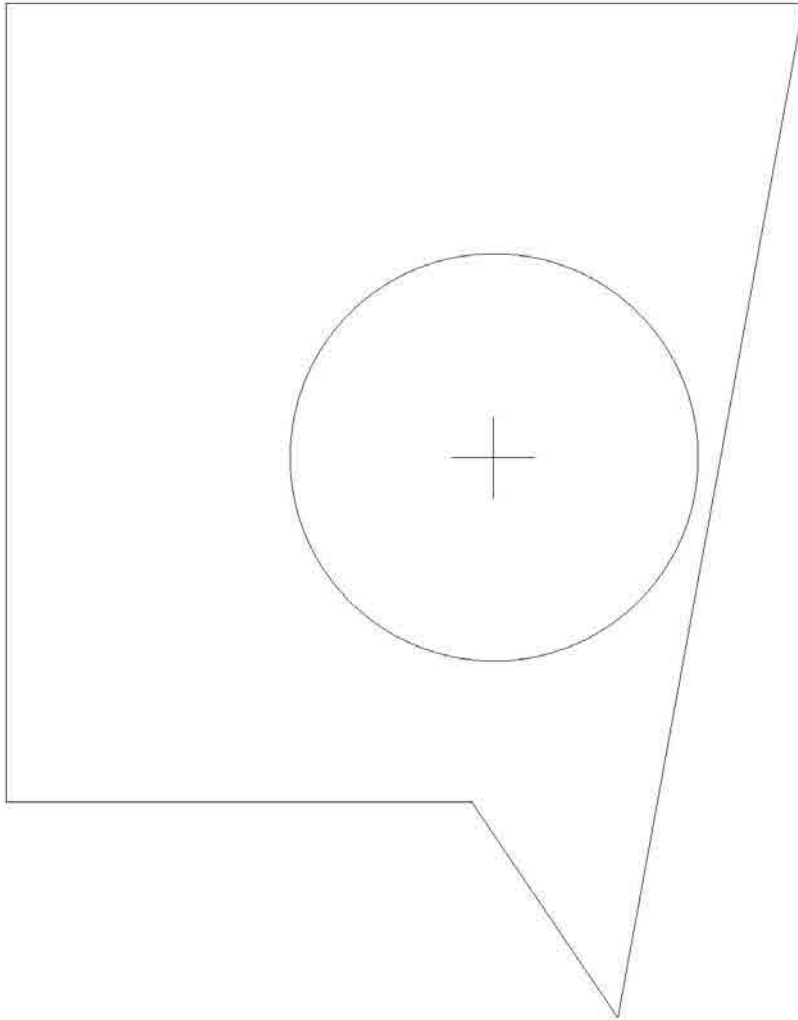


Figure 2

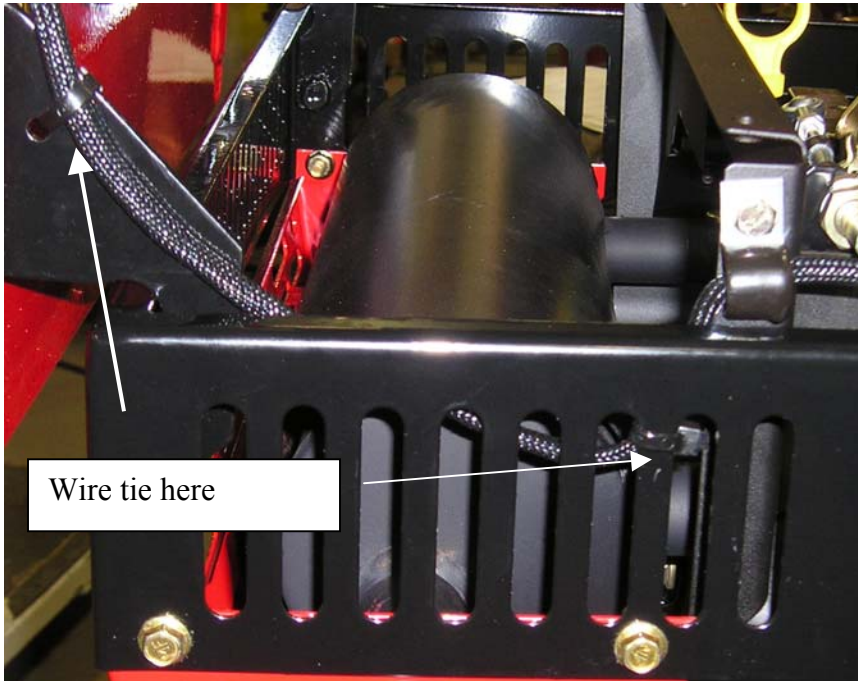


Figure 3

