



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

SERVICE BULLETIN

Fuel pump contamination possible on 440 Kohler

Date: January 03, 2013

Bulletin No: JC-13-01

Product Type: Steiner 440 with Kohler Engine

Customer Issue: Tractor will not run

Cause: Contaminants from the fuel tank can damage the fuel pump not allowing it to pump fuel

Action required: Install a fuel filter between the tank and the fuel pump. See page 2.

Products Involved: 34HP & 40HP Kohler-Equipped 440 tractors
75-72012 34hp tractors before serial number 75720120148
75-72013 40hp tractors before serial number 75720130152

Warranty: You may claim up to .3 hour of labor and parts for units covered under this bulletin. Please file warranty using Service Bulletin Number JC-13-01 with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000.

This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE

☒

WARRANTY

☒

SALES


☒

PARTS

☒



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

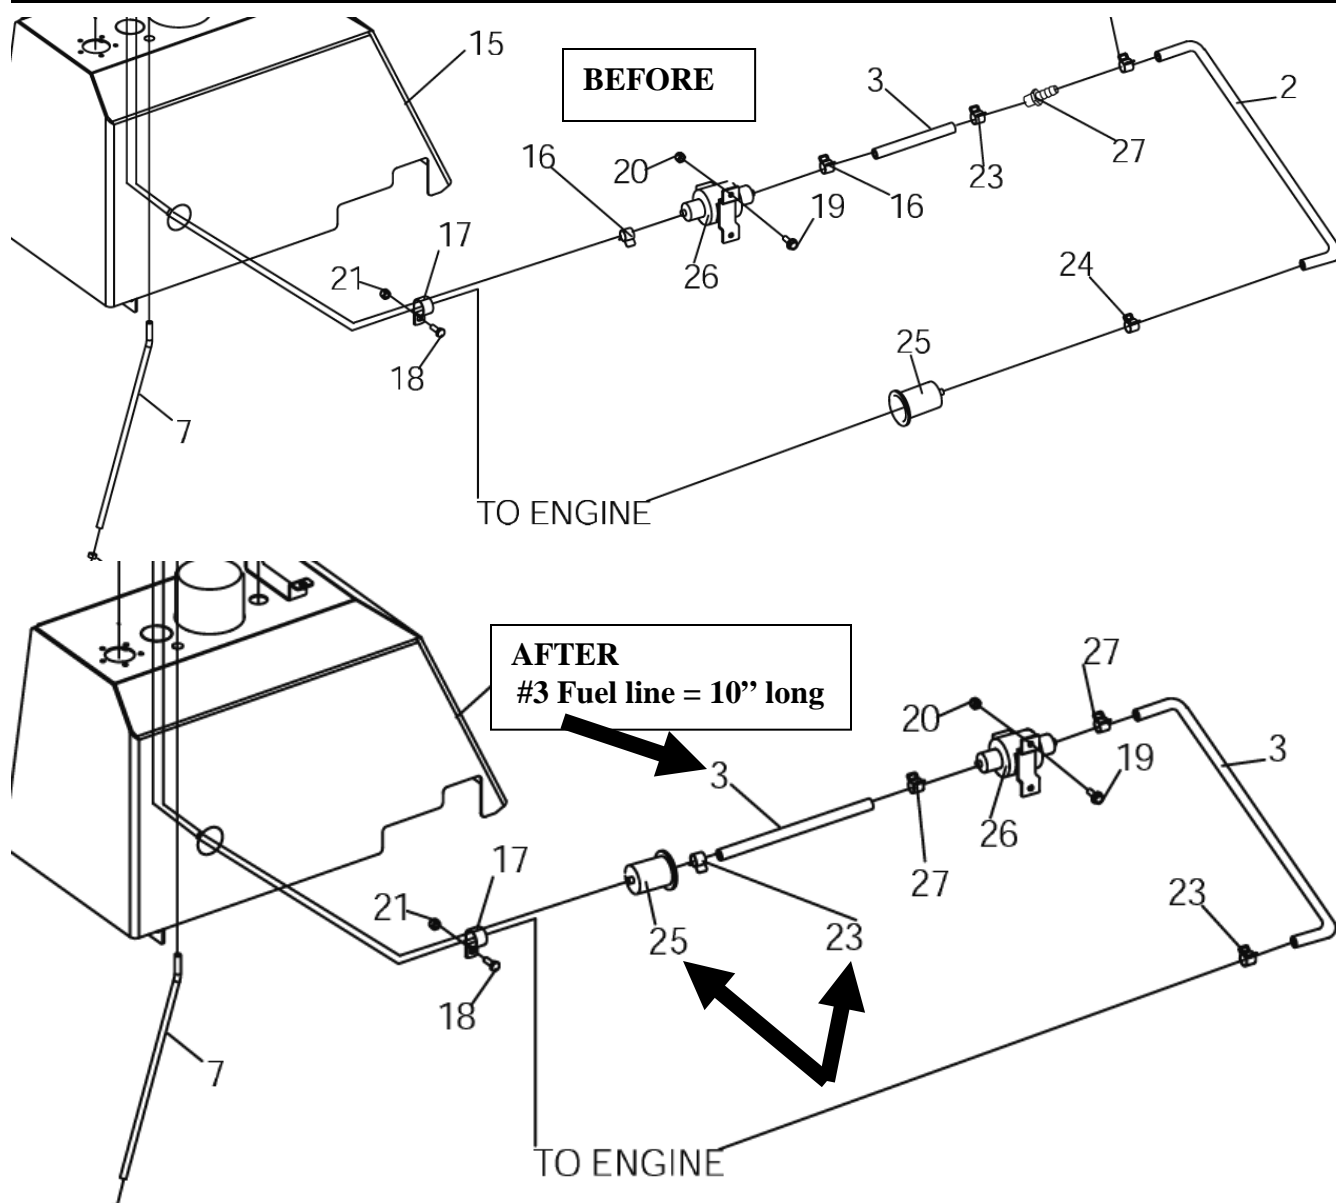

1. Order these parts: 1 of 13-12581-43012 fuel filter (ref 25) and 2 of 88042-02 5/16 clamp (ref 23).
2. Locate and clamp the fuel line coming out of the tank with a fuel line clamp.
3. Measure back 10" from the fuel pump and cut the fuel line. Use caution. A small amount of gas will drain out of the fuel line.
4. Cut approximately 2.25" of fuel line off of the fuel line attached to the tank.
5. Install the clamps and fuel filter, making sure the filter is turned properly for proper fuel flow.
6. Release the fuel line clamp and check for leaks.
7. Run the engine and let it bleed out the air in the fuel line.