



One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

SERVICE BULLETIN

Date: August 30, 2012

Bulletin No: JC-013-12

Product Type: G & H series ProCat & Predator-Pro

Customer Issue: Electrical short – fuse blows

Cause: Main wire harness is chafing on top of hydraulic tank.

Products Involved:

Model Number	Description	Up to serial
942500G	ProCat 22HP Kaw w/52" SD	00701
942501G	ProCat 26HP Kaw w/52" SD	00296
942502G	ProCat 26HP Kaw w/61" SD	00700
942504G	ProCat 29HP Kaw w/61" SD	00896
942506G	ProCat 29HP Kaw w/52" SD	00232
942507G	ProCat 29HP Kaw w/61" RD	00155
942508G	ProCat 29HP Kaw w/72" SD	00181
942509G	Predator-Pro 30HP GEN LP w/61" SD	00100
942510G	Predator-Pro 30HP GEN LP w/61" RD	00105
942514G	Predator-Pro 34HP Kaw w/61" SD	00654
942515G	Predator-Pro 37HP DFI Kaw w/61" SD	00050
942517G	ProCat 22HP Kaw w/48" SD	00172
942519G	Predator-Pro 34HP Kaw w/72" SD	00155
942520H	ProCat SE KOH CV680 52" SD	00309
942521H	ProCat SE KOH CV740 61" SD	00445
942522H	ProCat SE FX651V Kaw w/52" SD	00194
942523H	ProCat SE FX730V Kaw w/61" SD	00237

Action Required: Re-route harness as shown on the next page.

Make Your Move™




One BOB-CAT Lane, P.O. Box 469
Johnson Creek, WI 53038 U.S.A.
(920) 699 2000
Fax: (920) 699 6836

Page 2 of 2

(Tank & seat removed for clarity in these two pictures)



Tie-strap main harness into notch (if brake harness is not through hole as shown you'll need to re-route it to make room for main harness)

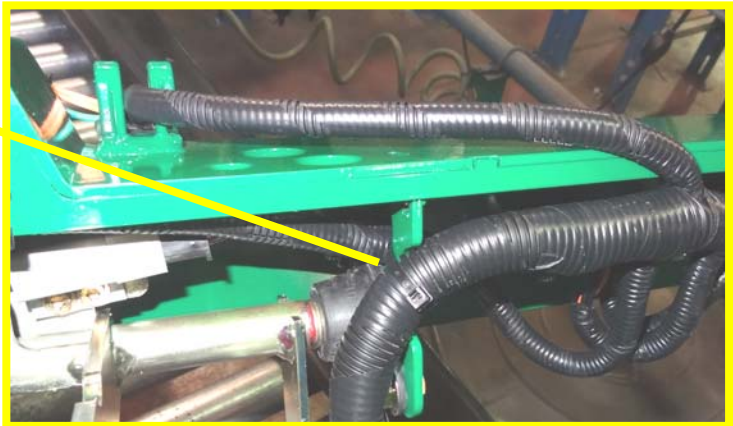

Harness should already be under control rod as shown. If not, re-route it.

Warranty: You may claim up to a .3 hour of labor for units affected under this bulletin. Please file a "labor only" warranty claim using Service Bulletin Number JC-013-12 with one unit per claim.

If you have any questions, please contact our Customer Service Department at 920-699-2000. This bulletin is relevant to the departments checked below. Please circulate as appropriate.

SERVICE

☒

WARRANTY

☒

SALES

☐

PARTS

☐

Make Your Move™